

Date & Time: 3-22-2014 1100

Crew: RK, BT, MP

Sheet 1 of 2

Location: PRM 145

Weather: Clear

Camera: 77-216-6000-1

GPS Unit: PRX


Comments: Camera-1 Photos #539-544 left channel looking right #544 looking US from left snow bank along main channel #544 left channel looking DS #544 snow bank along main channel right side looking left

(A) Sample #	(B) GPS Point #	(D) Snow Depth (ft)	(E) Ice Thickness (ft)	(F) Top of Ice to Bed Distance (ft)	(G) Flow Depth (F-E) (ft)	(H) Frazil Ice Present?	(I) Anchor Ice Present?	(J) Freeboard Height (ft)	(K) Camera Height above Bed (ft)	(L) Video #	(M) Comments / Bed Description
S1	1	0.5	3.5	115	6.1	Y	N	0.2	4	119	
S2	2	0.5	3.5	119	6.4	Y	N	0.1	4	120	
S3	3	0.5	3.8	106	5.0	Y	N	0.2	4	121	
S4	4	0.5	3.5	114	6.0	Y	N	0.2	4	122	
S5	5	0.5	3.5	112	5.8	Y	N	0.3	4	123	
S6	6	0.5	3.4	113	6.0	Y	N	0.3	4	124	
S7	7	0.5	4.0	117	5.75	Y	N	0.3	4	125	
S8	8	0.5	3.2	115	6.4	Y	N	0.4	4	126	
S9	9	0.3	3.5	111	5.75	Y	N	1.3	4	127	
S10	10	0.3	3.6	115	6.0	Y	N	0.3	4	128	
S11	11	0.3	3.3	120	6.9	Y	N	0.3	4	129	
S12	12	0.3	3.5	114	6.0	Y	N	0.4	4	130	
S13	13	0.1	4.0	112	5.3	Y	N	0.4	4	131	
S14	14	0.1	3.6	113	5.8	Y	N	0.4	4	132	
S15	15	0.1	3.8	113	5.6	Y	N	0.3	4	133	
S16	16	0.1	4.1	121	5.9	Y	N	0.4	4	134	

Photo Back up # 301

Aerial Photos Camera - 1

- # 543 508
- ~~544~~ 509
- 545 510
- ~~546~~ 511
- ~~547~~ 512
- ~~548~~ 513
- ~~549~~ 514

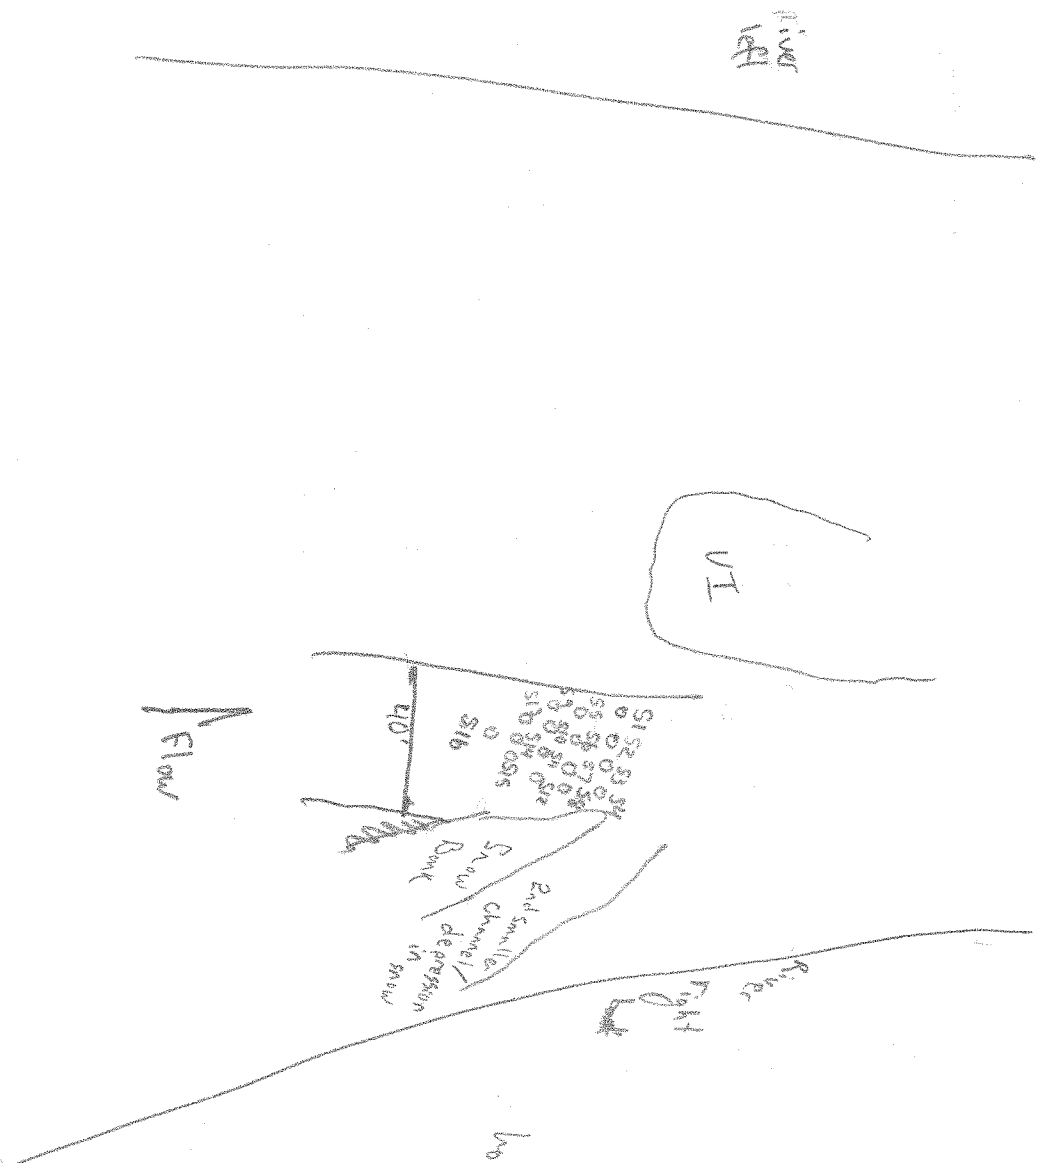

holes spread ~8'

QC1 *[Signature]*

phot B up Kilgus Area # 302

3/22/14